



DRAPE COMPOSITION 1 PENDANT - INSTALLATION INSTRUCTIONS

GLOVES (NITRILE) ARE PROVIDED AND **MUST BE WORN DURING INSTALLATION TO AVOID FINGERPRINTS ON THE FINISH OF THE EXPOSED METAL PARTS.**

This product must be installed in accordance with the applicable codes by a person familiar with the construction and operation of the product and the hazards involved, preferably a licensed electrician. Use maximum 7W bulb.

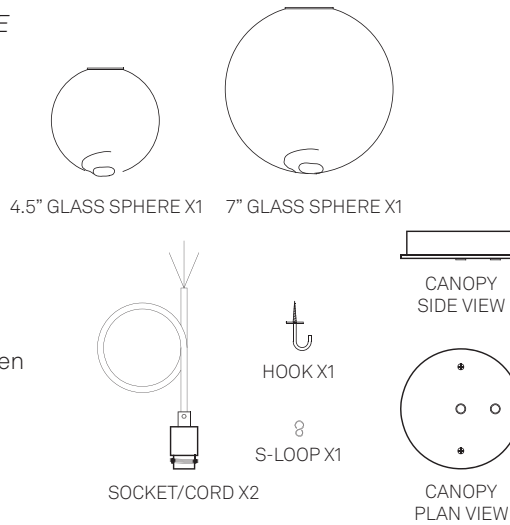


Figure 1. Parts of the Light Fixture Assembly

1 Uncoil and gently smooth the fabric-wrapped electrical cords of each pendant. Determine the desired length of each cord and trim each one, making sure to leave enough additional length to make the wiring connections within the canopy. When trimming the fabric-wrapped electrical cords make sure to use electrical tape or other means to secure the fabric at the location of the cut, and then at the cut end to avoid splaying or fraying or slack in the fabric.

2 Slide the provided brass "S" loop onto the cord of the pendant which will be the off-set/swagged pendant.

3 Pass the fabric-wrapped electrical cords of each individual pendant through the holes in the canopy. Use the provided strain reliefs to fix the length of the cord of each pendant. Do not over-crimp the strain reliefs or damage the electrical cords.

4 Carefully supporting the fixture, connect the exposed leads of the fixture to the leads in the electrical box according to the wiring diagram (Figure 2) using the wire and wire connectors provided.

5 This pendant requires an electrical box with available holes at 3 1/2" on center spacing. If a box with differently spaced threaded holes is present, additional parts may be required to install the fixture properly, such as a universal cross bar (not supplied). Install the canopy by fastening the two supplied 8/32 thread brass machine screws directly into the appropriate holes in the electrical box through the holes and guides provided as part of the canopy, making sure that canopy sits flat and flush against finish surface.

6 Determine the composition for your Drape Composition 1, and install the brass hook for the smaller off-set pendant into the ceiling at the desired location. Hook is supplied with anchor for drywall ceiling - use other anchor as necessary. Carefully slide the brass loop along the fabric wrapped electrical cord taking great care not to tear or mar the fabric. Use a needlenose pliers with taped jaws to slightly crimp the loop to fix the loop slightly into place. Hang the cord on the hook by slipping the open loop over the end of the hook.

7 Install the supplied LED light bulbs (7W Max) into the sockets.

8 Carefully thread a glass sphere onto each socket. Do not overtighten. Install the large diameter glass sphere onto the central pendant, and the smaller diameter glass sphere onto the off-set pendant supported on the ceiling hook/loop.

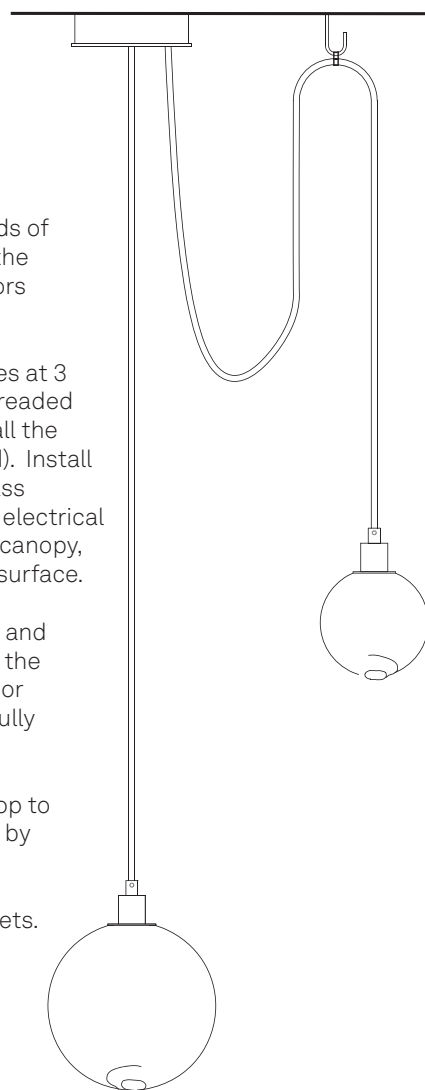


Figure 3. Completed fixture

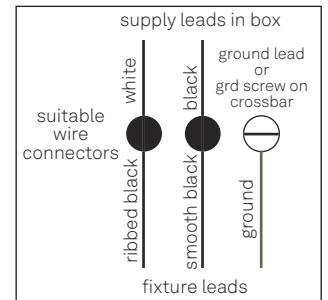


Figure 2. Wiring Diagram

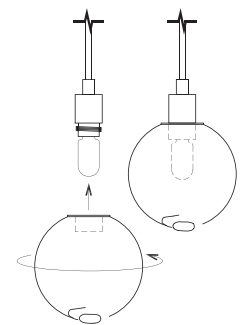


Figure 4. Install glass spheres by threading onto brass sockets